

**Project: PSD: Kamiak Elementary School****Date: November 29, 2018****Weather conditions:**

Date	Hi/Low	Precip	Snow	Forecast	Avg. HI / LO
Wed 11/28	47°/36°	0.03 IN	0 IN	Mostly cloudy, a shower	38°/27°
Thu 11/29	46°/33°	0 IN	0 IN	Considerable cloudiness	38°/27°
Fri 11/30	41°/30°	0.07 IN	0.2 IN	A p.m. rain or snow shower	38°/27°
Sat 12/1	39°/27°	0 IN	0 IN	Rather cloudy	38°/27°
Sun 12/2	36°/25°	0 IN	0 IN	Mostly cloudy	37°/26°
Mon 12/3	35°/23°	0 IN	0 IN	Mostly cloudy	37°/26°
Tue 12/4	34°/19°	0 IN	0 IN	A snow shower possible	37°/26°
Wed 12/5	30°/18°	0.22 IN	3.7 IN	Cloudy	36°/26°

**Discussion with:** See Construction Progress Meeting minutes dated 11/29/18**Construction Activities:**

1. It appears the developer has applied straw erosion control to the lots north of the Kamiak site. The pallets of building materials on the asphalt path belong to Kamiak contractor(s). The Kamiak contractor is aware they damaged the asphalt path in bubbled area and will repair it in the spring.





2. The stake in the center of this photo is the location where the Kamiak northern sewer pipe ends. The connection was not made by the developer. View is looking to the east.



3. The developer's contractor is not sure where the end of their sewer pipe is located. They will be back next week to dig up both pipes and make the connection.






4. The inverted “T” in this photo designates where it is believed the “Y” is located for connection of the sewer line mentioned above. It appears that this “Y” is down stream of the pipe from Kamiak.



5. It appears the contractor has taken delivery of more glazing. We are hoping that all exterior glazing will be installed soon so the contractor can finish installation of framing closure pieces.

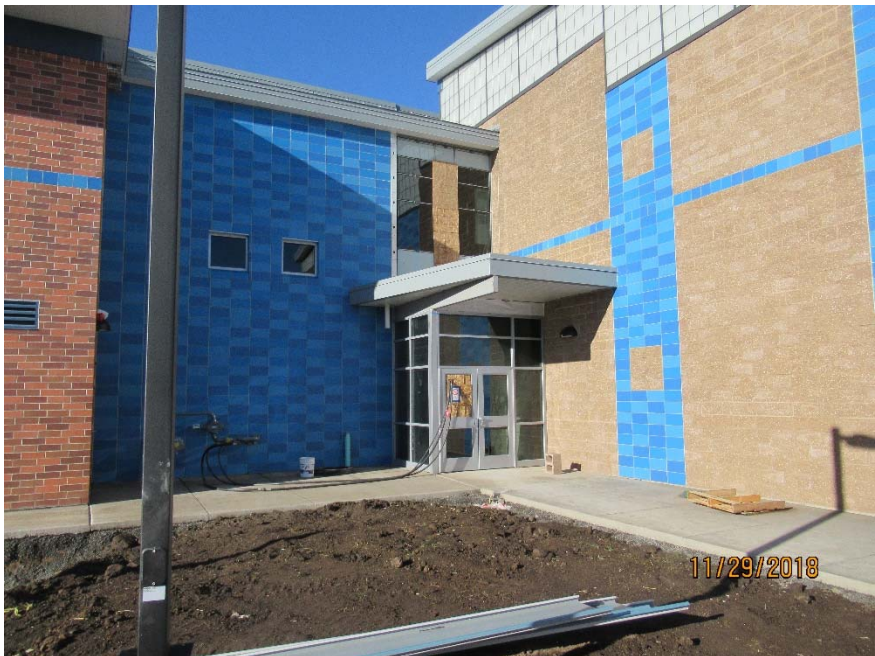



6. Contractor has installed one set of precast caps at the top of the 2 columns at the main entrance.



7. Masons constructing the school monument signage masonry.





8. It appears the painting has been completed at the main entrance. Where the wallboard appears unfinished is where compact laminate will be installed.



9. Gymnasium painting lower wall is underway.





- 10. Painter has painted accent wall in Corridor 140 just south of the Gymnasium.**



- 11. Contractor has stripped the forms from the exterior stair from building to play area.**





**12. Casework installation on the lower floor Area B continues.**



**13. Corridor 120 looking south. Contractor has hung upper wall covering.**





**14. Installation of rest room  
toilet compartments is  
underway.**



**15. Corridor 220. Contractor  
has hung upper wall  
covering.**





**16. Flooring contractor has placed carpet and floor tile in the following classrooms: 202, 206, 207, 208, 211, 212, 213, 217, 221, 225, and carpet I work room 219.**



**Deficiencies:** The tall storefront at breakout spaces has not yet been sealed on the inside between floors. Both these issues are addressed in the commissioning issues log. Contractor installing incorrect glazing in interior window frames, contractor said today he is aware and the glazing will be replaced with correct.

**Dan Gordon**  
**Project Manager**

