

**Project: PSD: Kamiak Elementary School****Date: February 21, 2019****Weather conditions:**

Date	Hi/Low	Precip	Snow	Forecast	Avg. HI / LO
Thu 2/21	28°/14°	0 IN	0 IN	Clouds and sun; cold	42°/28°
Fri 2/22	29°/25°	0.04 IN	0.5 IN	A little afternoon snow	43°/28°
Sat 2/23	32°/23°	0.04 IN	0.6 IN	Mostly cloudy; cold	43°/28°
Sun 2/24	30°/17°	0.02 IN	0.3 IN	Snow showers; very cold	43°/28°
Mon 2/25	24°/14°	0 IN	0 IN	Clouds and sun; very cold	44°/28°
Tue 2/26	26°/15°	0.1 IN	0 IN	Overcast; very cold	44°/28°
Wed 2/27	33°/26°	0.09 IN	0 IN	Cloudy, snow showers possible	44°/28°

Discussion with: See Construction Progress Meeting minutes dated 2/21/19**Construction Activities:**

- The contractor has accepted delivery of appliances. This is accepted Alternate 9 – Residential Appliances.





2. Contractor continues installation of FRP in lower corridor.



3. Contractor has accepted delivery of corner guards.





4. Dishwasher installation in progress in Breakroom 118N.



5. In Breakroom 118N: It appears the vent and garbage disposal have been installed per direction. COP 78, the change of the faucet handles (shorter ADA) has yet to be priced.





- 6. Contractor has used screws and blocks of wood to secure the tack boards while the adhesive dries.**



- 7. Contractor will need to repair the wall where the screws were screwed into the wall.**





8. **Appears the contractor has applied adhesive for walk off carpet at Vestibule 100.**



9. **It appears the contractor still needs to repair wallboard at wood slat ceiling area.**





- 10. It appears the analog clock has been installed at the end of Corridor 126, in Corridor 140. The exit sign is not aligned with clock and Camera.**



- 11. Appears the contractor is prepping the Multi-Purpose room floor for tile.**





12. Although difficult to see in this photo, there is a piece of conduit that is half painted to match structure and the other half is red. Contractor notified today that the entire length of this conduit needs to be painted to match structure like the other conduits.



13. Although difficult to see in this photo, there are 3 pieces of conduit that are painted red. Contractor notified today that the entire length of these conduits need to be painted to match structure like the other conduits.





- 14. It appears the contractor has installed the shelving in the walk in refrigerator in the Kitchen.**



- 15. It appears the contractor has installed the insulation on the condensation line in the walk in freezer in the Kitchen.**





- 16. Appears the contractor is in the process of powering up the Kitchen roll up door.**



- 17. Appears the contractor has applied adhesive for walk off carpet at Vestibule 160.**





18. There appears to be a portion of the building that shows to have blue siding does not have siding. I notified the Architect of this today.



Deficiencies: None noticed at this time. Any challenges in this report can easily be a part of the Punch List if the contractor hasn't addressed the issue beforehand.

Dan Gordon
Project Manager

